

YOUR ONESURVEY
HOME REPORT

ADDRESS

83 Barkerland Avenue
Dumfries
DG1 4HR

PREPARED FOR

Andrew Macleod (on behalf of Dumfries & Galloway
Council)

INSPECTION CARRIED OUT BY:



SELLING AGENT:

Walker & Sharpe

HOME REPORT GENERATED BY:



Document Index

| Document | Status | Prepared By | Prepared On |
|------------------------|--------------|---|-------------|
| Single Survey | Final | Dumfries - Allied Surveyors Scotland Ltd | 10/03/2026 |
| Mortgage Certificate | Final | Dumfries - Allied Surveyors Scotland Ltd | 10/03/2026 |
| Property Questionnaire | Final | Mr. Andrew Macleod (on behalf of Dumfries & Galloway Council) | |
| EPC | FileUploaded | Dumfries - Allied Surveyors Scotland Ltd | 09/03/2026 |

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you log onto www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

| | |
|---------------------------|--|
| Surveyor Reference | DFS/26/203 |
| Customer | Mr. Andrew Macleod (on behalf of Dumfries & Galloway Council) |
| Selling address | 83 Barkerland Avenue Dumfries DG1 4HR |
| Date of Inspection | 09/03/2026 |
| Prepared by | Simon Allen, Bsc MRICS Dumfries - Allied Surveyors Scotland Ltd |

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the “Surveyors” are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the “Surveyors” means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller’s permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor’s opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

| | |
|---|---|
| Description | The property consists of a purpose-built, top floor flat incorporated within a semi-detached, three-storey block of six similar dwellings. |
| Accommodation | Accommodation within the individual flat comprises:- Second floor: Entrance hall, living room, kitchen, 2 bedrooms and bathroom incorporating WC. |
| Gross internal floor area (m ²) | Approximately 68 m ² . |
| Neighbourhood and location | The property is situated within an established residential development on the south side of Dumfries, comprising a mixture of social and former social housing. Neighbouring properties are mostly of a similar age and style. The property is reasonably convenient for local amenities and lies within approximately 1.5 miles of Dumfries town centre. |
| Age | The property is believed to date from around 1952. |
| Weather | Overcast with intermittent rain showers. |
| Chimney stacks | Visually inspected with the aid of binoculars where required. There is a single, shared chimney stack, which is of brick construction with lead flashings. |

| | |
|--|---|
| <p>Roofing including roof space</p> | <p>Sloping roofs were visually inspected with the aid of binoculars where required.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The roof is pitched, timber framed and clad with concrete interlocking tiles over roofing felt and fibreboard sarking. There are concrete ridge tiles. A cast-iron skylight is incorporated within the rear roof elevation.</p> <p>A restricted inspection of the roof void was available through a ceiling hatch in the entrance hall. This revealed the presence of mineral wool insulation above ceilings to an average depth of approximately 270 mm.</p> |
| <p>Rainwater fittings</p> | <p>Visually inspected with the aid of binoculars where required.</p> <p>Seamless alloy rainwater gutters connect to PVC and cast-iron downpipes.</p> |
| <p>Main walls</p> | <p>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</p> <p>The main walls are of non-traditional construction, comprising 'no-fines concrete', with a roughcast external finish. The walls are plastered on the hard internally.</p> |
| <p>Windows, external doors and joinery</p> | <p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>Windows are of a UPVC framed casement design, incorporating sealed unit double glazing. The entrance door leading from the shared landing to the flat is timber.</p> |
| <p>External decorations</p> | <p>Visually inspected.</p> <p>External joinery and cast-iron rainwater conductors have previously been painted.</p> |
| <p>Conservatories / porches</p> | <p>None.</p> |
| <p>Communal areas</p> | <p>Circulation areas visually inspected.</p> <p>Circulation areas within the building include a ground floor entrance hall, stairs and upper landings.</p> |
| <p>Garages and permanent outbuildings</p> | <p>Visually inspected.</p> <p>The property is understood to include two small storage compartments, one situated on the upper landing and the other at ground level, contained within a small brick built and flat roofed rear off-shoot.</p> |

| | |
|--|--|
| <p>Outside areas and boundaries</p> | <p>Visually inspected.</p> <p>There are communal grounds and drying areas, which lie to the front side and rear of the block of flats and are mostly laid to grass. There are shared footpaths. Boundaries are generally defined by timber fencing and privet hedges.</p> <p>An external door leads from the living room to a small balcony.</p> |
| <p>Ceilings</p> | <p>Visually inspected from floor level.</p> <p>Ceilings would appear to be lined with plasterboard.</p> |
| <p>Internal walls</p> | <p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>Internal partition walls are of solid construction with a plaster finish.</p> |
| <p>Floors including sub floors</p> | <p>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>The floors would appear to be either of suspended timber or suspended, reinforced concrete construction. An inspection of floor surfaces was severely restricted due to the presence of securely fitted floor coverings</p> |
| <p>Internal joinery and kitchen fittings</p> | <p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>Internal joinery includes timber skirting boards, facings, flush faced doors and surrounds, much of which would appear to be original. There are built-in cupboards in each of the bedrooms.</p> <p>The kitchen has been provided with a range of base and wall mounted cupboard units, with laminated doors and fitted worktops. There is an inset stainless steel sink unit.</p> |
| <p>Chimney breasts and fireplaces</p> | <p>Visually inspected. No testing of the flues or fittings was carried out.</p> <p>An open fronted gas fire has been installed in the living room, set within the original tiled fireplace. The chimney breast is solid masonry with a plaster finish.</p> |
| <p>Internal decorations</p> | <p>Visually inspected.</p> <p>Papered and/or painted finishes have been applied to most wall and ceiling surfaces. Internal joinery has been painted.</p> |
| <p>Cellars</p> | <p>None.</p> |

| | |
|--|--|
| <p>Electricity</p> | <p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</p> <p>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p> <p>Mains electricity is connected, serving 13 amp square pin sockets. Visible wiring was seen to be PVC sheathed and insulated. A pre-pay type electricity meter and fuse box are located in the landing cupboard.</p> |
| <p>Gas</p> | <p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.</p> <p>Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p> <p>Mains gas is connected.</p> |
| <p>Water, plumbing and bathroom fittings</p> | <p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Mains water is connected and visible plumbing was generally seen to be copper. There is a galvanised cold water storage tank located in the roof space.</p> <p>Bathroom fittings consist of a white suite comprising WC, wash hand basin and low level bath. There is an electric shower fitting above the bath.</p> |
| <p>Heating and hot water</p> | <p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>There is no central heating system within the property. Space heating is provided by night storage heaters in the entrance hall and bedrooms, with a wall mounted fan heater in the bathroom.</p> <p>Domestic hot water is provided by an electric immersion system fitted to an insulated hot water storage cylinder located in the living room cupboard.</p> |
| <p>Drainage</p> | <p>Drainage covers etc were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Drainage is to the main sewer.</p> |

| | |
|---------------------------------------|--|
| <p>Fire, smoke and burglar alarms</p> | <p>Visually inspected.</p> <p>No test whatsoever were carried out to any systems or appliances.</p> <p>A smoke detector has been installed in the entrance hall. This provision does not meet current fire safety standards, which are as detailed beneath.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked.</p> <p>Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</p> |
|---------------------------------------|--|

| | |
|--|---|
| <p>Any additional limits to inspection</p> | <p>At the time of inspection, the property was unoccupied and unfurnished. Floor coverings were present throughout the property, severely restricting an inspection of floor surfaces. Subfloor areas could not be accessed.</p> <p>Only the subject flat and internal communal areas giving access to the flat were inspected.</p> <p>If the roof space or under-building/basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated.</p> <p>Windows and external doors were not all fully opened or tested.</p> <p>The report does not include an asbestos inspection. However, asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.</p> <p>A physical inspection of the roof void area was restricted due to insulation material and lack of suitable crawl boards. As a result, the roof void area was only viewed from the access hatch.</p> <p>Concealed areas beneath and around the bath were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.</p> <p>We do not carry out an inspection for Japanese Knotweed, which is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. We have assumed that there is no Japanese Knotweed within the boundaries of the property or in neighbouring properties. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists, removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p> |
|--|---|

Sectional Diagram showing elements of a typical house





Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the above 3 categories:

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

| Structural movement | |
|---------------------|---|
| Repair category: |  |
| Notes: | A minor crack is evident within the rear wall oof the property. There are however no indications of recent or significant structural movement affecting the building. |

| Dampness, rot and infestation | |
|-------------------------------|---|
| Repair category: |  |
| Notes: | There is damp staining to sections of the fibreboard sarking beneath the roof tiles, with an additional damp stain in the ceiling of the living room. |

| Chimney stacks | |
|------------------|---|
| Repair category: |  |
| Notes: | No significant defects were identified from ground level. |

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

Roofing including roof space

| | |
|------------------|--|
| Repair category: | 2 |
| Notes: | <p>The roof tiles appear to be original and are therefore of considerable age. There is widespread moss growth on the surface of the tiles, a displaced ridge tile and a corroded cast-iron skylight.</p> <p>There is damp staining to the fibreboard sarking boards beneath the tiles. Sections of the sarking are also loose or distorted, with evidence of torn roofing felt beneath.</p> <p>Concrete tiles typically have a reasonable life expectation of around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair/replacement costs. Advice should be sought prior to making a commitment to purchase.</p> |

Rainwater fittings

| | |
|------------------|---|
| Repair category: | 2 |
| Notes: | Rainwater gutters are blocked with vegetation growth and are overflowing. |

Main walls

| | |
|------------------|--|
| Repair category: | 1 |
| Notes: | Whilst no immediate action would appear to be necessary, the roughcast finish applied to external wall surfaces is original, and some surface weathering is apparent. Where accessible, sections of the roughcast were also noted to be hollow and may require future attention. |

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

Windows, external doors and joinery

| | |
|------------------|---|
| Repair category: | 2 |
| Notes: | <p>At least one of the double glazed window seals would appear to have failed, resulting in a build-up of condensation between the panes of glass. Windows were not all fully opened or tested, and it should be appreciated that some defects are only evident during certain weather conditions. The windows are of an age and style where a degree of ongoing maintenance should be anticipated to sealed units and opening mechanisms.</p> <p>The soffit bboards at eaves level may contain asbestos material and care or specialist advice should be taken when carrying out any work affecting these building components.</p> |

External decorations

| | |
|------------------|--|
| Repair category: | 1 |
| Notes: | Regular decorative maintenance will be required. |

Conservatories / porches

| | |
|------------------|-----------------|
| Repair category: | |
| Notes: | Not applicable. |

Communal areas

| | |
|------------------|---|
| Repair category: | 2 |
| Notes: | <p>The flat roof above the rear single-storey off-shoot appears to be defective and leaking.</p> <p>There is deterioration to the concrete mullions of the stairwell windows, exposing the iron reinforcing bars. Some of the glazing units are cracked. Some decorative attention is required.</p> |

Garages and permanent outbuildings

| | |
|------------------|-----------------------------------|
| Repair category: | 1 |
| Notes: | No significant issues were noted. |

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

| Outside areas and boundaries | |
|------------------------------|-----------------------------------|
| Repair category: | 1 |
| Notes: | No significant issues were noted. |

| Ceilings | |
|------------------|-----------------------------------|
| Repair category: | 1 |
| Notes: | No significant issues were noted. |

| Internal walls | |
|------------------|-----------------------------------|
| Repair category: | 1 |
| Notes: | No significant issues were noted. |

| Floors including sub-floors | |
|-----------------------------|---|
| Repair category: | 1 |
| Notes: | Where floor surfaces were accessible, no significant issues were noted. |

| Internal joinery and kitchen fittings | |
|---------------------------------------|---|
| Repair category: | 1 |
| Notes: | Internal joinery and kitchen fittings are generally dated and some wear and tear is apparent. |

| Chimney breasts and fireplaces | |
|--------------------------------|--|
| Repair category: | 1 |
| Notes: | It is assumed that the gas fire in the living room has been properly installed and maintained in accordance with all current regulations, with particular emphasis on flueing and ventilation requirements. A visual inspection revealed no obvious issues, although the fire was not lit at the time of inspection. |

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

| Internal decorations | |
|----------------------|--|
| Repair category: | 1 |
| Notes: | Decoration is largely a personal matter, and prospective purchasers may therefore consider at least some redecoration to be desirable. |

| Cellars | |
|------------------|-----------------|
| Repair category: | |
| Notes: | Not applicable. |

| Electricity | |
|------------------|---|
| Repair category: | 2 |
| Notes: | <p>Some aspects of the electrical installation are dated, including the fuse box, which does not meet current electrical standards. It should be noted that relevant trade associations recommend that electrical installations be checked every ten years or on change of ownership, in order to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.</p> <p>There is no evidence of recent testing of the electrical system and a competent electrical contractor should therefore be instructed to test the installation.</p> |

| Gas | |
|------------------|--|
| Repair category: | 1 |
| Notes: | Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations. |

| Category 3 | Category 2 | Category 1 |
|--|---|--|
| Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now. | Repairs or replacement requiring future attention, but estimates are still advised. | No immediate action or repair is needed. |

Water, plumbing and bathroom fittings

| | |
|------------------|---|
| Repair category: | 2 |
| Notes: | <p>The galvanised cold water storage tank in the roof space is original and is likely to be affected by internal corrosion. Its replacement should be considered.</p> <p>Bathroom fittings are dated and the surface of the bath is discoloured. Prospective purchasers may consider upgrading of the bath suite to be desirable.</p> |

Heating and hot water

| | |
|------------------|--|
| Repair category: | 2 |
| Notes: | <p>The hot water storage cylinder is dated and poorly insulated. Staining to the surface of the cylinder may be indicative of leakage. Its replacement is recommended.</p> |

Drainage

| | |
|------------------|---|
| Repair category: | 1 |
| Notes: | <p>A surface inspection within the immediate vicinity of the property revealed no obvious issues.</p> |

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

| | |
|--|---|
| Structural movement | 1 |
| Dampness, rot and infestation | 2 |
| Chimney stacks | 1 |
| Roofing including roof space | 2 |
| Rainwater fittings | 2 |
| Main walls | 1 |
| Windows, external doors and joinery | 2 |
| External decorations | 1 |
| Conservatories / porches | |
| Communal areas | 2 |
| Garages and permanent outbuildings | 1 |
| Outside areas and boundaries | 1 |
| Ceilings | 1 |
| Internal walls | 1 |
| Floors including sub-floors | 1 |
| Internal joinery and kitchen fittings | 1 |
| Chimney breasts and fireplaces | 1 |
| Internal decorations | 1 |
| Cellars | |
| Electricity | 2 |
| Gas | 1 |
| Water, plumbing and bathroom fittings | 2 |
| Heating and hot water | 2 |
| Drainage | 1 |

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

| | |
|--|---|
| 1. Which floor(s) is the living accommodation on? | Second floor |
| 2. Are there three steps or fewer to a main entrance door of the property? | <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO |
| 3. Is there a lift to the main entrance door of the property? | <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO |
| 4. Are all door openings greater than 750mm? | <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO |
| 5. Is there a toilet on the same level as the living room and kitchen? | <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO |
| 6. Is there a toilet on the same level as a bedroom? | <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO |
| 7. Are all rooms on the same level with no internal steps or stairs? | <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO |
| 8. Is there unrestricted parking within 25 metres of an entrance door to the building? | <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO |

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

| | |
|--|--|
| Matters for a solicitor or licensed conveyancer | |
| <p>The assumed tenure is absolute ownership.</p> <p>Roads and footpaths within the vicinity of the development have been made up and are believed to be maintained at public expense.</p> <p>The building is of non-traditional, 'no-fines' concrete construction. This is a type of solid concrete construction, without the use of sand. This type of construction is considered to be suitable for security purposes by most major lenders, although prospective purchasers should satisfy themselves in this regard in respect of their chosen mortgage provider.</p> <p>Details should be confirmed with regard to the maintenance of communal circulation areas and external grounds, together with any associated costs.</p> <p>It is assumed that responsibility for the maintenance of common building elements, such as the chimney stack, roof coverings and rainwater conductors, is on a shared and equitable basis. Details should be confirmed.</p> <p>Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the cost implications of these issues prior to making an offer to purchase.</p> | |
| Estimated re-instatement cost (£) for insurance purposes | |
| <p>£195,000</p> <p>One Hundred and Ninety Five Thousand Pounds. This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</p> | |
| Valuation (£) and market comments | |
| <p>£62,000</p> <p>The market value of the property as described in this report is Sixty Two Thousand Pounds. This figure assumes vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights.</p> | |
| Report author: | Simon Allen, Bsc MRICS |
| Company name: | Dumfries - Allied Surveyors Scotland Ltd |
| Address: | 35 Buccleuch Street Dumfries DG1 2AB |

| | |
|------------------------|---|
| Signed: | Electronically Signed: 308673-26356689-8508 |
| Date of report: | 10/03/2026 |

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.



Mortgage Valuation Report

Mortgage Valuation Report

| | | | |
|---------------------|---|---|----------------------------|
| Property: | 83 Barkerland Avenue Dumfries DG1 4HR | Client: Mr. Andrew Macleod (on behalf of Dumfries & Galloway Council) | Tenure: Absolute Ownership |
| Date of Inspection: | 09/03/2026 | Reference: | DFS/26/203 |

This report has been prepared as part of the seller's instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising a potential lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The property is situated within an established residential development on the south side of Dumfries, comprising a mixture of social and former social housing. Neighbouring properties are mostly of a similar age and style. The property is reasonably convenient for local amenities and lies within approximately 1.5 miles of Dumfries town centre.

| | | |
|------------------------|-----------------|-------------------------|
| 2.0 DESCRIPTION | 2.1 Age: | Constructed circa 1952. |
|------------------------|-----------------|-------------------------|

The property consists of a purpose-built, top floor flat incorporated within a semi-detached, three-storey block of six similar dwellings. There are common use circulation areas and shared grounds surrounding the block of flats

3.0 CONSTRUCTION

The roof is pitched, timber framed and clad with concrete interlocking tiles.

The main walls are of non-traditional construction, comprising 'no-fines concrete', with a roughcast external finish.

Floors are of suspended timber or reinforced concrete construction.

4.0 ACCOMMODATION

Accommodation within the individual flat comprises:-

Second floor: Entrance hall, living room, kitchen, 2 bedrooms and bathroom incorporating WC.

5.0 SERVICES (No tests have been applied to any of the services)

| | | | | | | | |
|-------------------------|--|---------------------|-------|-------------|-------|------------------|------------|
| Water: | Mains | Electricity: | Mains | Gas: | Mains | Drainage: | Main sewer |
| Central Heating: | No central heating. Space heating provided by electric night storage and wall mounted heaters. | | | | | | |

6.0 OUTBUILDINGS

| | |
|----------------|----------------------------|
| Garage: | None. |
| Others: | Two small integral stores. |

| | |
|------------|--|
| 7.0 | GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i> |
|------------|--|

A number of matters were identified during the course of inspection which, whilst not an exhaustive list, with the following:-

1. A minor crack is evident within the rear wall oof the property. There are however no indications of recent or significant structural movement affecting the building.
2. The roof tiles appear to be original and are therefore of considerable age. There is widespread moss growth on the surface of the tiles, a displaced ridge tile and a corroded cast-iron skylight. There is damp staining to the fibreboard sarking boards beneath the tiles. Sections of the sarking are also loose or distorted, with evidence of torn roofing felt beneath. A reputable roofing contractor can advise on life expectancy and repair/replacement costs.
3. Rainwater gutters are blocked and require to be cleared of vegetation.
4. The windows are of an age and style where a degree of ongoing maintenance should be anticipated to sealed units and opening mechanisms. At least one of the double glazing seals would appear to have failed.
5. Some aspects of the electrical installation are dated, including the fuse box, which does not meet current electrical standards. There is no evidence of recent testing of the electrical system and a competent electrical contractor should therefore be instructed to test the installation.

| | |
|------------|--|
| 8.0 | ESSENTIAL REPAIR WORK <i>(as a condition of any mortgage or, to preserve the condition of the property)</i> |
|------------|--|

None.

| | |
|-----------------------------------|-----|
| 8.1 Retention recommended: | n/a |
|-----------------------------------|-----|

| | |
|------------|------------------------------|
| 9.0 | ROADS & FOOTPATHS |
|------------|------------------------------|

Made up and adopted.

| | | | | | |
|-------------|---------------------------------|---------|----------------------------------|----|----------------------|
| 10.0 | BUILDINGS INSURANCE (£): | 195,000 | GROSS EXTERNAL FLOOR AREA | 78 | Square metres |
|-------------|---------------------------------|---------|----------------------------------|----|----------------------|

This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.

| | |
|-------------|------------------------|
| 11.0 | GENERAL REMARKS |
|-------------|------------------------|

At the time of inspection, the property was unoccupied and unfurnished. Floor coverings were present throughout. Weather conditions were overcast with intermittent rain showers.

The building is of non-traditional, 'no-fines' concrete construction. This is a type of solid concrete construction, without the use of sand. This type of construction is considered to be suitable for security purposes by most major lenders, although prospective purchasers should satisfy themselves in this regard in respect of their chosen mortgage provider.

Details should be confirmed with regard to the maintenance of communal circulation areas and external grounds, together with any associated costs.

It is assumed that responsibility for the maintenance of common building elements, such as the chimney stack, roof coverings and rainwater conductors, is on a shared and equitable basis. Details should be confirmed.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the cost implications of these issues prior to making an offer to purchase.

| | | | |
|---|--|--|----------------------------|
| 12.0 | VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i> | | |
| 12.1 | Market Value in present condition (£): | £62,000 | Sixty Two Thousand Pounds. |
| 12.2 | Market Value on completion of essential works (£): | n/a | n/a |
| 12.3 | Suitable security for normal mortgage purposes? | Yes | |
| 12.4 | Date of Valuation: | 10/03/2026 | |
| Signature: | | Electronically Signed: 308673-26356689-8508 | |
| Surveyor: | Simon Allen | Bsc MRICS | Date: 10/03/2026 |
| Dumfries - Allied Surveyors Scotland Ltd | | | |
| Office: | 35 Buccleuch Street Dumfries DG1 2AB | Tel: 01387 254 425 Fax: email: dumfries@alliedsurveyorsscotland.com | |

PART 3.

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

| | |
|-------------------------|---|
| Property address | 83 Barkerland Avenue Dumfries DG1 4HR |
|-------------------------|---|

| | |
|-----------------|---|
| Customer | Mr. Andrew Macleod (on behalf of Dumfries & Galloway Council) |
|-----------------|---|

| | |
|-------------------------|---|
| Customer address | 83 Barkerland Avenue Dumfries DG1 4HR |
|-------------------------|---|

| | |
|--------------------|--|
| Prepared by | Simon Allen, Bsc MRICS Dumfries - Allied Surveyors Scotland Ltd |
|--------------------|--|

Energy Performance Certificate (EPC)

Scotland

Dwellings

83 BARKERLAND AVENUE, DUMFRIES, DG1 4HR

Dwelling type: Top-floor flat
Date of assessment: 09 March 2026
Date of certificate: 09 March 2026
Total floor area: 68 m²
Primary Energy Indicator: 279 kWh/m²/year


Reference number: 6616-6027-6200-0601-0202
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Electric storage heaters

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

| | | |
|--|---------------|--|
| Estimated energy costs for your home for 3 years* | £7,212 | See your recommendations report for more information |
| Over 3 years you could save* | £4,038 | |

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

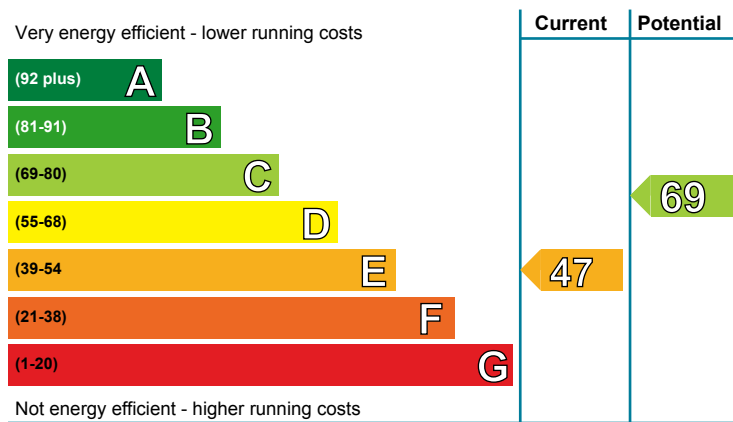


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (47)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

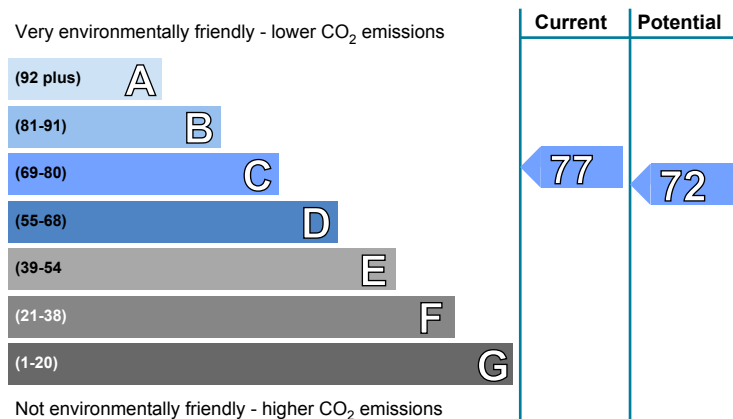

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (77)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

| Recommended measures | Indicative cost | Typical savings over 3 years |
|--|------------------|------------------------------|
| 1 Increase hot water cylinder insulation | £20 - £40 | £417.00 |
| 2 Low energy lighting | £60 - £70 | £90.00 |
| 3 Gas condensing boiler | £3,500 - £10,000 | £3531.00 |

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

| Element | Description | Energy Efficiency | Environmental |
|-----------------------|--|-------------------|---------------|
| Walls | System built, as built, no insulation (assumed) | ★☆☆☆☆ | ★☆☆☆☆ |
| | System built, as built, partial insulation (assumed) | ★★★★☆ | ★★★★☆ |
| Roof | Pitched, 270 mm loft insulation | ★★★★★ | ★★★★★ |
| Floor | (another dwelling below) | — | — |
| Windows | Mostly double glazing | ★★☆☆☆ | ★★☆☆☆ |
| Main heating | Electric storage heaters | ★★★★☆ | ★★★★★ |
| Main heating controls | Manual charge control | ★★☆☆☆ | ★★☆☆☆ |
| Secondary heating | Room heaters, mains gas | — | — |
| Hot water | Electric immersion, off-peak | ★★☆☆☆ | ★★★★★ |
| Lighting | Below average lighting efficiency | ★★☆☆☆ | ★★☆☆☆ |

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 29 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.0 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.







Estimated energy costs for this home

| | Current energy costs | Potential energy costs | Potential future savings |
|---------------|----------------------|------------------------|---|
| Heating | £4,521 over 3 years | £2,121 over 3 years |  |
| Hot water | £2,400 over 3 years | £906 over 3 years | |
| Lighting | £291 over 3 years | £147 over 3 years | |
| Totals | £7,212 | £3,174 | |

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

| Recommended measures | Indicative cost | Typical saving per year | Rating after improvement | |
|---|------------------|-------------------------|---|---|
| | | | Energy | Environment |
| 1 Increase hot water cylinder insulation | £20 - £40 | £139 |  |  |
| 2 Low energy lighting for all fixed outlets | £60 - £70 | £30 |  |  |
| 3 Change heating to gas condensing boiler | £3,500 - £10,000 | £1177 |  |  |

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Micro CHP
- Cavity, internal or external wall insulation

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Hot water cylinder insulation

Increasing the thickness of existing insulation around the hot water cylinder will help to maintain the water at the required temperature; this will reduce the amount of energy used and lower fuel bills. An additional cylinder jacket or other suitable insulation layer can be used. The insulation should be fitted over any thermostat clamped to the cylinder. Hot water pipes from the hot water cylinder should also be insulated, using pre-formed pipe insulation of up to 50 mm thickness, or to suit the space available, for as far as they can be accessed to reduce losses in summer. All these materials can be purchased from DIY stores and installed by a competent DIY enthusiast.

2 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

3 Gas condensing boiler

Changing the heating to use a mains gas boiler that provides both space and water heating will save money, as mains gas is currently cheaper than the fuel being used at present. A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat the property, but there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). This improvement is most appropriate when the existing heating system needs repair or replacement. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer. It is also recommended to change the electricity tariff to standard tariff when off-peak is no longer used for heating.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

| Heat demand | Existing dwelling | Impact of loft insulation | Impact of cavity wall insulation | Impact of solid wall insulation |
|------------------------------|-------------------|---------------------------|----------------------------------|---------------------------------|
| Space heating (kWh per year) | 9,308.9 | N/A | N/A | N/A |
| Water heating (kWh per year) | 2,855.27 | | | |

Addendum

This dwelling is a system built property or some of its walls are of non-conventional construction and may be exposed to wind driven rain and requires further investigation to establish the type of construction, the type of wall insulation best suited (cavity insulation or internal/external insulation) and the savings it might deliver. Please contact the Home Energy Scotland hotline on 0808 808 2282 to find out more.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

| | |
|-----------------------------|--|
| Assessor's name: | Mr. Simon Allen |
| Assessor membership number: | EES/008215 |
| Company name/trading name: | Allied Surveyors Scotland Ltd |
| Address: | 35 Buccleuch Street Dumfries DG1 2AB |
| Phone number: | 01387 254 424 |
| Email address: | dumfries@alliedsurveyorsscotland.com |
| Related party disclosure: | No related party |

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

83 Barkerland Avenue

Dumfries

DG1 4HR

Seller(s)

Andrew Macleod (on behalf of
Dumfries & Galloway Council)

Completion date of property questionnaire

Note for sellers

| | |
|-----------|--|
| 1. | Length of ownership |
| | <p>How long have you owned the property?</p> <p>Don't know</p> |
| 2. | Council tax |
| | <p>Which Council Tax band is your property in? (Please circle)</p> <p><input checked="" type="checkbox"/>A <input type="checkbox"/>B <input type="checkbox"/>C <input type="checkbox"/>D <input type="checkbox"/>E <input type="checkbox"/>F <input type="checkbox"/>G <input type="checkbox"/>H</p> |
| 3. | Parking |
| | <p>What are the arrangements for parking at your property?</p> <p>(Please tick all that apply)</p> <p>Garage <input type="checkbox"/></p> <p>Allocated parking space <input type="checkbox"/></p> <p>Driveway <input type="checkbox"/></p> <p>Shared parking <input type="checkbox"/></p> <p>On street <input type="checkbox"/></p> <p>Resident permit <input type="checkbox"/></p> <p>Metered parking <input type="checkbox"/></p> <p>Other (please specify): Don't known</p> |

property questionnaire

| | | |
|-----------|---|----------------------------------|
| 4. | Conservation area | |
| | Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? | [] YES [] NO [x] Don't know |
| 5. | Listed buildings | |
| | Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)? | [] YES [] NO |
| 6. | Alterations/additions/extensions | |
| a | (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? | [] YES [] NO |
| | If you have answered yes, please describe below the changes which you have made: | |
| | (ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? | [] YES [] NO |
| | If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. | |
| | If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them: | |
| b | Have you had replacement windows, doors, patio doors or double glazing installed in your property | [] YES [] NO |
| | If you have answered yes, please answer the three questions below: | |
| | (i) Were the replacements the same shape and type as the ones you replaced? | [] YES [] NO |
| | (ii) Did this work involve any changes to the window or door openings? | [] YES [] NO |
| | (iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent. | |
| 7. | Central heating | |
| a | Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom). | [] YES [] NO [] Partial |

property questionnaire

| | If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). | | | | | | | | | | | | | | | | | | | | | | | | | |
|---|---|--|-----------|----------|-----------------------------|---|--|-------------------------------------|---|--|-------------|---|--|----------------|---|--|-----------|---|--|-----------------------|---|--|-----------|---|--|--|
| | If you have answered yes, please answer the three questions below: | | | | | | | | | | | | | | | | | | | | | | | | | |
| | (i) When was your central heating system or partial central heating system installed? <i>Don't know</i> | | | | | | | | | | | | | | | | | | | | | | | | | |
| | (ii) Do you have a maintenance contract for the central heating system? | <input type="checkbox"/> YES <input type="checkbox"/> NO | | | | | | | | | | | | | | | | | | | | | | | | |
| | If you have answered yes, please give details of the company with which you have a maintenance contract | | | | | | | | | | | | | | | | | | | | | | | | | |
| | (iii) When was your maintenance agreement last renewed? (Please provide the month and year). | | | | | | | | | | | | | | | | | | | | | | | | | |
| 8. Energy Performance Certificate | | | | | | | | | | | | | | | | | | | | | | | | | | |
| | Does your property have an Energy Performance Certificate which is less than 10 years old? | <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO | | | | | | | | | | | | | | | | | | | | | | | | |
| 9. Issues that may have affected your property | | | | | | | | | | | | | | | | | | | | | | | | | | |
| a | Has there been any storm, flood, fire or other structural damage to your property while you have owned it? | <input type="checkbox"/> YES <input type="checkbox"/> NO | | | | | | | | | | | | | | | | | | | | | | | | |
| | If you have answered yes, is the damage the subject of any outstanding insurance claim? | <input type="checkbox"/> YES <input type="checkbox"/> NO | | | | | | | | | | | | | | | | | | | | | | | | |
| b | Are you aware of the existence of asbestos in your property? | <input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> Don't know | | | | | | | | | | | | | | | | | | | | | | | | |
| | If you have answered yes, please give details: | | | | | | | | | | | | | | | | | | | | | | | | | |
| 10. Services | | | | | | | | | | | | | | | | | | | | | | | | | | |
| a | Please tick which services are connected to your property and give details of the supplier: | | | | | | | | | | | | | | | | | | | | | | | | | |
| | <table border="1"> <thead> <tr> <th>Services</th> <th>Connected</th> <th>Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas or liquid petroleum gas</td> <td>N</td> <td></td> </tr> <tr> <td>Water mains or private water supply</td> <td>N</td> <td></td> </tr> <tr> <td>Electricity</td> <td>N</td> <td></td> </tr> <tr> <td>Mains drainage</td> <td>N</td> <td></td> </tr> <tr> <td>Telephone</td> <td>N</td> <td></td> </tr> <tr> <td>Cable TV or satellite</td> <td>N</td> <td></td> </tr> <tr> <td>Broadband</td> <td>N</td> <td></td> </tr> </tbody> </table> | Services | Connected | Supplier | Gas or liquid petroleum gas | N | | Water mains or private water supply | N | | Electricity | N | | Mains drainage | N | | Telephone | N | | Cable TV or satellite | N | | Broadband | N | | |
| Services | Connected | Supplier | | | | | | | | | | | | | | | | | | | | | | | | |
| Gas or liquid petroleum gas | N | | | | | | | | | | | | | | | | | | | | | | | | | |
| Water mains or private water supply | N | | | | | | | | | | | | | | | | | | | | | | | | | |
| Electricity | N | | | | | | | | | | | | | | | | | | | | | | | | | |
| Mains drainage | N | | | | | | | | | | | | | | | | | | | | | | | | | |
| Telephone | N | | | | | | | | | | | | | | | | | | | | | | | | | |
| Cable TV or satellite | N | | | | | | | | | | | | | | | | | | | | | | | | | |
| Broadband | N | | | | | | | | | | | | | | | | | | | | | | | | | |

| | | |
|--|---|--|
| b | Is there a septic tank system at your property? | <input type="checkbox"/> YES <input type="checkbox"/> NO |
| | If you have answered yes, please answer the two questions below: | |
| | (i) Do you have appropriate consents for the discharge from your septic tank? | <input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know |
| | (ii) Do you have a maintenance contract for your septic tank? | <input type="checkbox"/> YES <input type="checkbox"/> NO |
| | If you have answered yes, please give details of the company with which you have a maintenance contract: | |
| 11. Responsibilities for shared or common areas | | |
| a | Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details: | <input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know |
| b | Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details: | <input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> N/A |
| c | Has there been any major repair or replacement of any part of the roof during the time you have owned the property? | <input type="checkbox"/> YES <input type="checkbox"/> NO |
| d | Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details: | <input type="checkbox"/> YES <input type="checkbox"/> NO |
| e | As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details: | <input type="checkbox"/> YES <input type="checkbox"/> NO |
| f | As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details: | <input type="checkbox"/> YES <input type="checkbox"/> NO |
| 12. Charges associated with your property | | |
| a | Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges: | <input type="checkbox"/> YES <input type="checkbox"/> NO |
| b | Is there a common buildings insurance policy? | <input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> Don't know |
| | If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges? | <input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know |

| | | |
|------------|---|--|
| c | Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund. | |
| 13. | Specialist works | |
| a | As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? | <input type="checkbox"/> YES <input type="checkbox"/> NO |
| | If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property. | |
| b | As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? | <input type="checkbox"/> YES <input type="checkbox"/> NO |
| | If you have answered yes, please give details: | |
| c | If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? | <input type="checkbox"/> YES <input type="checkbox"/> NO |
| | If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by: | |

| | | |
|-----------------------|---|---|
| 14. Guarantees | | |
| a | Are there any guarantees or warranties for any of the following: | |
| (i) | Electrical work | <input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost |
| (ii) | Roofing | <input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost |
| (iii) | Central heating | <input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost |
| (iv) | National House Building Council(NHBC) | <input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost |
| (v) | Damp course | <input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost |
| (vi) | Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy) | <input type="checkbox"/> NO <input type="checkbox"/> YES <input checked="" type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost |
| b | If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s): | |
| c | Are there any outstanding claims under any of the guarantees listed above? | <input type="checkbox"/> YES <input type="checkbox"/> NO |
| | If you have answered yes, please give details: | |

| | | |
|--|---|--|
| 15. Boundaries | | |
| | So far as you are aware, has any boundary of your property been moved in the last 10 years? | <input type="checkbox"/> YES <input type="checkbox"/> NO <input checked="" type="checkbox"/> Don't know |
| | If you have answered yes, please give details: | |
| 16. Notices that affect your property | | |
| In the past three years have you ever received a notice: | | |
| a | advising that the owner of a neighbouring property has made a planning application? | <input type="checkbox"/> YES <input type="checkbox"/> NO |
| b | that affects your property in some other way? | <input type="checkbox"/> YES <input type="checkbox"/> NO |
| c | that requires you to do any maintenance, repairs or improvements to your property? | <input type="checkbox"/> YES <input type="checkbox"/> NO |
| | If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property. | |

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

| | |
|---------------|---|
| Signature(s): | Andrew Hunter |
| Capacity: | <input type="checkbox"/> Owner <input checked="" type="checkbox"/> Legally Appointed Agent for Owner |
| Date: | 17/03/2026 |